



# 1 July 2022 – 30 September 2022 Environmental Monitoring Results Summary

Name of Mine	Northparkes Mines
Name of Leaseholder and Mine Operator	CMOC Mining Pty Ltd
Mining Leases	ML1247, ML1367, ML1641 AND ML1743
Environment Protection Licence	EPL 4784
Development Consent	DC11_0060 (as modified)

Reviewed by	Chris Higgins
Title	Superintendent – Environment & Farms
Date Signature	CHiggins
	0 0
Approved by	Stacey Kelly
Title	Manager – People, Safety & Environment
Date	Sto MI
Signature	





## SCOPE OF REPORT

This report provides a summary of monitoring results for the period from 1 July to 30 September 2022. This monitoring is undertaken in accordance with the Environmental Monitoring Program (available at www.northparkes.com.au). Details of air quality, noise, water and vibration monitoring locations are available in the Environmental Monitoring Program. Refer to appendix A for all monitoring location maps.

## 2. AIR QUALITY

The air quality monitoring program utilises PM<sub>10</sub> (beta attenuated monitors), TSP's (high volume air samplers (HVAS)) and depositional dust gauges. Monitoring locations are strategically positioned around the mine lease and neighbouring properties. TSP and PM<sub>10</sub> monitoring have been undertaken at three nearby farm residences Hubberstone, Milpose and Hillview. A summary of the monitoring results are provided below.

#### 2.1 PM10

 $PM_{10}$  monitoring results for the 'Hubberstone', 'Milpose' and 'Hillview' monitoring locations, for the reporting period, are displayed in Figure 1, Figure 2 and Figure 3 respectively. The criteria for exceedances (as nominated in the Development Consent DC11\_0060, known as the Consent), are >30  $\mu g/m^3$  for the annual average and >50  $\mu g/m^3$  for a 24-hour monitoring period.

During the reporting period no exceedances of the Consent criteria were recorded.

Milpose monitoring unit incurred an instrumentation issue during the month of September. The issue has since been rectified.

#### **Annual Averages:**

Year to date annual averages recorded at all monitoring locations are below the Consent criteria of  $30 \, \mu g/m^3$ , recording:

- 7.7 μg/m³ at Hubberstone
- 8.9 μg/m³ at Milpose, and
- 7.0 μg/m³ at Hillview.





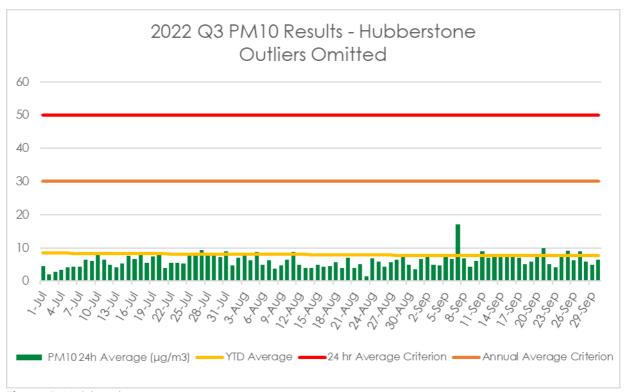


Figure 1: Hubberstone

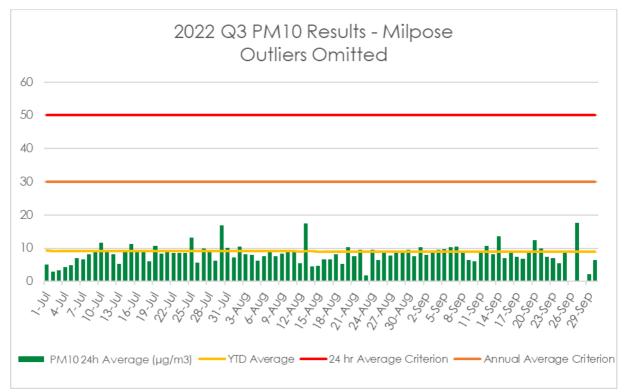


Figure 2: Milpose





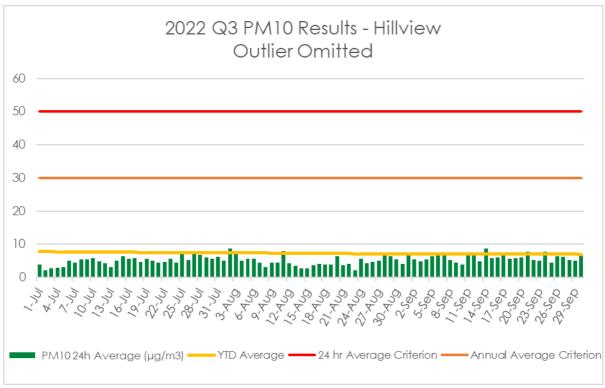


Figure 3: Hillview

#### 2.2 TSP

Hubberstone, Milpose and Hillview all recorded dust levels at the TSP monitoring locations under the required average annual criteria set by the Consent (90  $\mu g/m^3$ ) for the quarter for the reporting period.

Missing data during the period at Hubberstone and Milpose locations was the result of instrumentation malfunction. As part of Modification 6 to remove TSP and depositional dust from the monitoring program, a conversion factor can be applied to calculate TSP concentrations and demonstrate compliance with the conditions of Consent. This conversion factor has been applied to Milpose and Hubberstone locations, estimating the TSP concentrations for the period 1 July to 30 September.

During the reporting period no exceedances of the Consent criteria were recorded.

#### **Annual Averages:**

Annual averages recorded at all monitoring locations are significantly below the Consent criteria of 90  $\mu$ g/m³, recording:

- 15.1 μg/m³ at Hubberstone
- 19.5 µg/m³ at Milpose, and
- 14.7 µg/m³ at Hillview.





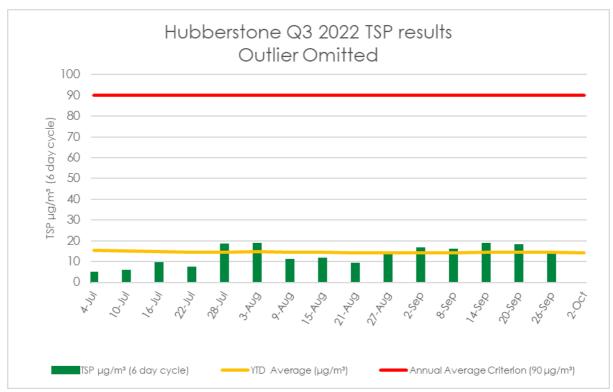


Figure 4: Hubberstone

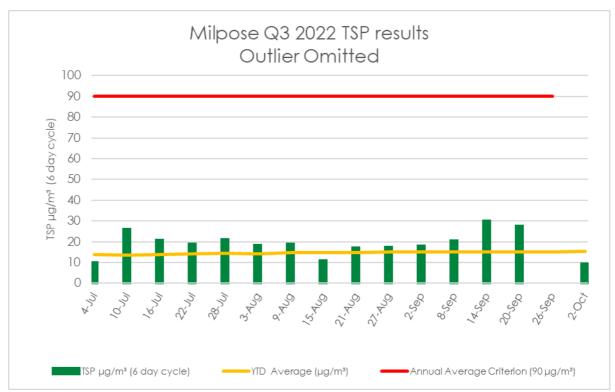


Figure 5: Milpose





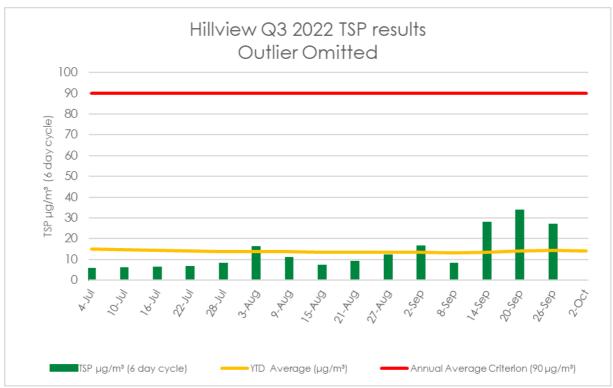


Figure 6: Hillview

## 2.3 Depositional Dust

Depositional dust gauges record the total of deposited dust for a month-long period and are a measure of broad scale changes to the local air quality.

Eleven depositional dust gauges are located across the mining lease and neighbouring residential properties to monitor atmospheric dust. A summary of the monthly monitoring results at each monitoring location are presented the figures below. Please be advised that only monitoring locations ND19, ND20, ND21 & ND22 are regulated by the criteria stated in the Consent, as they are the only depositional dust gauges that are at a residence on privately-owned land. All other depositional dust gauges are used to inform operational activities.

The indicative annual average for all locations are below the long-term impact assessment criteria (4 g/m²/month), complying with the conditions of the Consent.

During the monitoring period, ND22 recorded results above the internal trigger value of 4 g/m²/month, recording 7.5 g/m²/month in July and 5.3 g/m²/month in September. An internal investigation was undertaken for this result and is detailed below.

## **ND22**

• <u>July 7.5 g/m2/month and Sept 5.3 g/m2/month</u>: Minimal agricultural activities have occurred due to the excessive rainfall. Winds during the month predominantly prevailed from a south westerly direction, supporting the assessment that the source of the particulate matter was to be non-mine related.





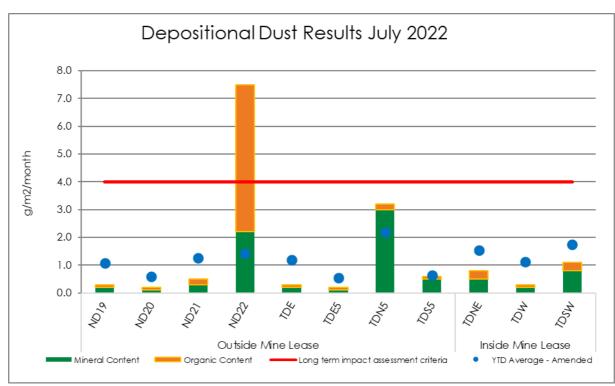


Figure 7: July depositional dust results for all locations

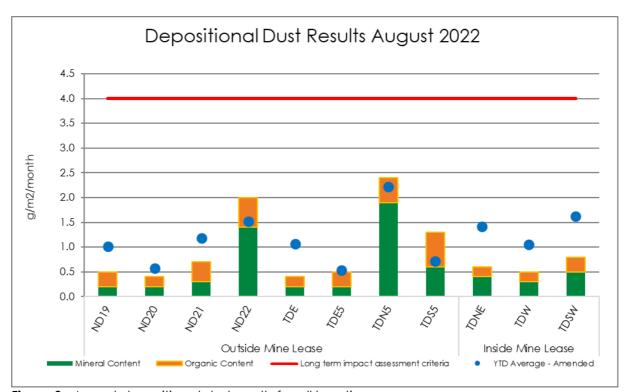


Figure 8: August depositional dust results for all locations





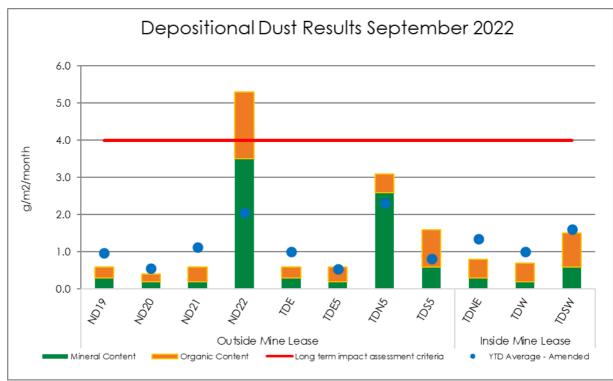


Figure 9: September depositional dust results for all locations





## 3. WATER

#### 3.1 Overview

Water management at Northparkes is undertaken in accordance with approved management plans, prepared in accordance with the Consent. All water samples are analysed at an independent National Association of Testing Authorities (NATA) accredited laboratory.

Surface water quality monitoring is undertaken at Northparkes specifically within the three defined water management systems of;

- Clean water management system, which includes farm dams and watercourses;
- Dirty water management system, which includes settlement ponds; and
- Contaminated water management system, which includes all aspects of ore processing, and retention ponds.

The groundwater monitoring program at Northparkes aims to identify any changes to the natural groundwater system as a result of mining operations and ensure compliance with the Consent. It focuses on potential impacts to environmental assets and groundwater users in the area surrounding Northparkes.

Monitoring results are assessed and interpreted utilising historical trend analysis and internal water quality criteria and trigger levels to identify potential changes.





# 3.2 Quarterly Monitoring Analysis

Water quality monitoring was carried out generally in accordance with the Consent, with no significant changes to the pH or EC for all locations. Copper concentrations increased at several locations, although results are still in consistent with long term data. These locations will be closely monitored during the future reporting periods. A summary of the monitoring results at each location sampled are presented in Tables 1-7 below.

Monitoring resumed within the western side of TSF2 following removal of the exclusion zone. Access to MB01, MB03 AND MB05 was restricted during the quarter due to significant rainfall and construction on the eastern wall of TSF2.

**Table 1:** Process Water System

141614 1111100000 11															
Location	RP01	RP02	RP03	RP04	RP05	RP06	RP07	RP08	RP09	RP12	RP13	RP15	RP16	RP19	RP20
рH	7.95	7.72	8.49	Insufficient water	8.75	8.95	8.26	8.18	8.84	8.27	7.41	7.62	Insufficient water	8.55	7.86
EC (u\$/cm)	318	619	1,745	Insufficient water	619	477	568	2,314	2,513	226	1,570	5,348	Insufficient water	3,792	1,654
Cu (mg/L)	0.077	0.07	0.065	Insufficient water	0.028	0.042	0.012	0.029	0.035	0.034	0.105	0.032	Insufficient water	0.009	0.041

Table 1 continued: Process Water System

Location	RP21	RP22	RP23	RP24	RP25	RP26	RP27	RP28	RP32	Caloola	GT02
рН	8.63	8.48	8.08	7.94	7.76	8.05	8.0	8.57	7.55	8.18	8.0
EC (uS/cm)	578	601	637	447	488	549	2,349	2,192	740	4,619	1,734
Cu (mg/L)	0.035	0.022	0.035	0.05	0.023	0.03	0.038	0.02	0.123	0.011	0.088

Table 2: Sediment Ponds

Table 2: coalinoin				
Location	SP03	SP10	SP15	SP33
рН	8.66	9.06	Insufficient water	8.62
EC (uS/cm)	1,433	145	Insufficient water	156
Copper (mg/L)	0.019	0.102	Insufficient water	0.032





#### Table 3: Farm Dams

Location	FD04	FD05	FD06	FD07	FD11	FD16	FD18	FD25	FD26	FD27
рН	7.79	8.7	7.99	8.02	8.95	8.31	7.98	8.15	8.67	8.58
EC (uS/cm)	100.0	110.0	89.7	84.5	177.5	134.0	2,737.0	140.1	185.0	151.2
Copper (mg/L)	0.024	0.016	0.014	0.017	0.074	0.024	0.014	0.024	0.04	0.024

#### Table 4: TSF Bores

Location	MB02	MB06B	W26	W27	W28	W29	W30	W31	W32
pH	7.05	7.18	7.48	12.24	7.39	12.9	7.78	8.65	12.22
EC (u\$/cm)	10,021.0	21,508.0	15,518.0	26,143.0	18,421.0	25,218.0	2,981.0	761.0	4,112.0
Copper (mg/L)	0.008	0.02	0.031	0.008	0.012	0.058	0.009	0.02	0.009

Table 5: Opencut Bores

Tuble 3. Opencor	DOIGS											
Location	MB10	MB11 (dry)	MB12	MB13	W14	W19	W20	W21	W22	W23	W24	W25
рН	6.86	dry	no access	6.99	7.73	7.75	7.15	7.54	7.62	7.6	7.61	7.41
EC (uS/cm)	13,450.0	dry	no access	27,847.0	7,038.0	7,450.0	14,886.0	26,871.0	6,277.0	4,782.0	2,703.0	2,678.0
Copper (mg/L)	0.011	dry	no access	0.016	0.016	0.002	0.037	0.018	0.02	0.02	0.009	0.018

Table 6: Underground Bores

Location	MB17	MB18	MB19	MB20	P101	P102	P103	P104	P139	P145	P149
рН	8.1	9.77	7.41	7.49	7.04	7.02	no sample	no sample	6.14	7.32	7.48
EC (u\$/cm)	1,071.0	16,774.0	18,639.0	14,939.0	10,087.0	27,891.0	no sample	no sample	35,640.0	110.0	27,127.0
Copper (mg/L)	0.009	0.025	0.004	0.033	0.002	0.005	no sample	no sample	0.01	0.009	0.002

Table 7: Regional Bores

Location	Moss #1	Wright	Far Hilliers	Long Paddock
рH	7.89	7.51	7.12	7.54
EC (uS/cm)	2,340.0	1,397.0	664.0	771.0
Copper (mg/L)	0.009	0.007	0.006	0.01





## 4. VIBRATION

### 4.1 Overview

The assessment criteria for blast impacts at Northparkes are based on the ANZECC Guideline, aimed to minimise annoyance to human comfort levels. Table 8 below shows the blast impact criteria as set out in the Schedule 3 Conditions 6-13 of the Consent.

**Table 8:** Vibration and overpressure criteria of DC11\_0060.

Location	Airblast overpressure (dB(Lin Peak))	Ground vibration (mm/s)	Allowable exceedance
Residence on privately owned land	120	10	0%
	115	5	5% of the total number of blasts over a period of 12 months
All public infrastructure	-	50 (or a limit determined by the structural design methodology in AS 2187.2-2006, or its latest version, or other alternative limit for public infrastructure, to the satisfaction of the Secretary)	0%

The blast monitoring program uses blast units which measure ground vibration and air overpressure at the residences of the four closest privately owned properties, "Hubberstone", "Hillview", "Milpose", and "Adavale". The program is designed to measure the effectiveness of control measures and ensure compliance with consent and licence conditions, relevant standards and corporate requirements. A summary of the monitoring results are provided below.

## 4.2 Quarterly Monitoring Analysis

During the reporting period, three surface blasts were undertaken during the monitoring period. The vibration and overpressure results are displayed below and show that results are well below the criteria in the Consent.

Vibration Results - E31	25 Aug 22	15 Sep 22	29 Sep 22
Criteria	5	5	5
Adavale	0.02	0.05	0.03
Hillview	0.07	0.08	0.07
Hubberstone	0.05	0.06	0.05
Milpose	0.02	0.03	0.03





Overpressure Results – E31	25 Aug 22	15 Sep 22	29 Sep 22
Criteria	115	115	115
Adavale	101.7	98	87.4
Hillview	89.7	95.7	89
Hubberstone	97.8	75.2	102.7
Milpose	87.5	100.5	97.7





## 5. NOISE

Operational noise is managed by CMOC in accordance with the approved Noise Management Plan (NMP). The NMP covers all operational activities with the potential to generate noise at Northparkes. It details specific noise management and mitigation measures, outlines monitoring and reporting requirements and provides clear definitions of the roles and responsibilities for noise management.

#### 5.1 Overview

CMOC undertakes a noise monitoring program that consists of both operator-attended and unattended surveys at the five nearest occupied residences 'Hubberstone', 'Milpose', 'Lone Pine', 'Hillview' and 'Adavale'.

Operator-attended noise measurements and recordings are undertaken outside the mining leases in order to quantify the intrusive noise emissions from construction and of general mine activity as well as the overall level of ambient noise. This noise monitoring was undertaken by an independent and suitably qualified noise professional.

## 5.2 Quarterly Monitoring Analysis

Attended noise monitoring was undertaken between Tuesday 27 to Wednesday 28 July 2022.

The assessment was completed to quantify site noise emissions against relevant noise criteria pertaining to Northparkes operations in accordance with Conditions 1 to 5 of Schedule 3 of the NSW Development Consent Conditions (DC11\_110060), Northparkes Noise Management Plan (NMP, 2019) and Traffic Management Plan (TMP, 2019).

Road noise monitoring identified that vehicle movements associated with shift change generated levels below the relevant road noise criteria specified in the TMP and NMP.

Attended monitoring has identified that operational emissions generated by Northparkes comply with relevant noise criteria at all monitoring locations for all assessment periods. Furthermore, project related noise emissions are generally barely audible at monitoring locations. Extraneous non-mining sources such as traffic, insects, wind in trees, birds, aircraft, residential and agricultural noise were audible during the monitoring period. A summary of the monitoring results at each monitoring location are presented in Tables 9-14 below.





**Table 9:** Attended noise monitoring results for Hubberstone

able 3 Operato	r-Attended i	Noise Surve	y Results –	Location NM1, H	lubberstone	
Date/Time (hrs)	Noise De	escriptor (dBA	re 20 μPa)	<ul><li>Meteorology</li></ul>	Description and SPL, dBA	
Ouration 15min	LAmax	LAeq	LA90	- Weteorology	Description and St E, dDA	
		•		Day		
27/07/2022					Wind 27-48	
16:57	61	44	36		Birds 25-61	
				- WD: SW	Livestock 25-51	
27/07/2022	61	43	33	WS: 1.0m/s	Traffic 25-51	
17:12				Stab Class: E	Residential Noise 30-56	
27/07/2022				_	NPM - Processing 25-35	
17:27	66	45	30		(barely audible <50% measurement)	
	Site LAe	q(15min) Contri	ibution		<30	
			Eve	ening		
26/07/2022						
20:06	57	40	34		Wind 31-57	
				WD: W	Insects 30-46	
26/07/2022	49	38	33	WS: 1.5m/s	Livestock 30-43	
20:21				Stab Class: D	NPM – Site Hum <30	
26/07/2022				_	(barely to just audible throughout)	
20:36	53	38	33			
	Site LAe	q(15min) Contri	bution		<30	
			N	ight		
26/07/2022	46	27	24		Wind 20 54	
23:00	46	37	34	WD-W	Wind 32-54	
26/07/2022				– WD: W	Livestock 30-40	
23:15	47	38	36	WS: 1.5m/s	Aircraft 30-43	
26/07/2022				<ul> <li>Stab Class: D</li> </ul>	NPM - Processing 30-39	
23:30	54	39	37		(just audible to audible throughout)	
Site LAeq(15min) Contribution					<35	
Site LA1(1min) Contribution				<40		





**Table 10:** Attended noise monitoring results for Lone Pine

Date/Time (hrs)	Noise D	Descriptor (dBA re 20 μPa)			Description and SPL, dBA	
Duration 15min	LAmax	LAeq LA90		<ul> <li>Meteorology</li> </ul>		
			Day			
27/07/2022	64			Wind 32-55		
15:56	61	45	39	WD- CW	Birds 30-62	
27/07/2022	EG	43	36	— WD: SW WS: 1.5m/s	Traffic 40-61	
16:11	56	43	36	- Stab Class: D	Livestock 30-40	
27/07/2022		40	25	- Stab Class: D	Dogs Barking 30-44	
16:26	62	43	35		NPM Inaudible	
	Site LA	Aeq(15min) Cont	tribution		<35	
			Evenir	ig		
26/07/2022	64	46	42		Wind 36-58	
21:06	04	40	72	- WD: W	Dogs Barking <40	
26/07/2022	58 45	45	40	WS: 1.5m/s	Traffic 37-64	
21:21		40	Stab Class: E	Aircraft 35-56		
26/07/2022	55	41	37	Stab Glass. E	Insects <35	
21:36	55	41	31		NPM Inaudible	
	Site LA	Aeq(15min) Cont	tribution		<35	
			Night	t		
26/07/2022	49	37	33		Wind 20-49	
22:00				— WD: W	Aircraft 25-46	
26/07/2022	58 34	34	30	WS: 1.0m/s	Dog Barking 20-43	
22:15	30	5-4	30	- Stab Class: D	MAC Operator 58	
26/07/2022	43 28	28	22		NPM Inaudible	
22:30	70				III manamara	
Site LAeq(15min) Contribution					<30	
	Site L	A1(1min) Contri	Site LA1(1min) Contribution			





 Table 11: Attended noise monitoring results for Milpose

Date/Time (hrs)	Noise [	Descriptor (dB/	A re 20 μPa)			
Duration 15min	LAmax	LAeq	LA90	<ul> <li>Meteorology</li> </ul>	Description and SPL, dBA	
			Day			
27/07/2022 13:59	62	43	34	– WD: SW	Wind 28-62	
27/07/2022 14:14	73	44	35	WS: 2.0m/s  — Stab Class: D	Birds 25-43 MAC Operator 73	
27/07/2022 14:14	53	35	30	— Stab Class. D	NPM Inaudible	
	Site LA	Aeq(15min) Conf	tribution		<30	
			Evenir	ng		
27/07/2022 19:16	51	38	33	WB 8W		
27/07/2022 19:31	46	39	34	WD: SW WS: 0.5m/s	Insects 25-51  Dogs Barking 30-51	
27/07/2022 19:46	51	37	30	— Stab Class: D	NPM Inaudible	
	Site LA	Aeq(15min) Conf	tribution		<30	
			Night	t		
27/07/2022 02:00	45	30	23			
27/07/2022 02:15	46	31	22	— WD: SW WS: 1.0m/s	Wind 20-46 Dogs Barking 20-25	
27/07/2022 02:30	42	30	23	— Stab Class: E	NPM Inaudible	
Site LAeq(15min) Contribution					<30	
	Site L	Site LA1(1min) Contribution				





Table 32: Attended noise monitoring results for Hillview

Table 6 Operato	or-Attended	Noise Surve	ey Results – I	Location NM4, H	illview	
Date/Time (hrs)	Noise [	Noise Descriptor (dBA re 20 μPa) Meteoro		Matauralaur	Description and SPL dPA	
Duration 15min	LAmax	LAeq	LA90	— Meteorology	Description and SPL, dBA	
27/07/2022 12:44	67	50	44		Wind 38-61	
27/07/2022 12:59	65	48	42	WD: SW WS: 2.0m/s	Birds 35-46 Traffic 35-67 NPM Inaudible	
27/07/2022 13:14	59	47	43	- Stab Class: D		
	Site L/	Aeq(15min) Con	tribution		<35	
			Evenir	ng		
27/07/2022 18:00	63	49	36		Traffic 23-61	
27/07/2022 18:15	60	47	38	<ul> <li>WD: W</li> <li>WS: 0.5m/s</li> <li>Stab Class: E</li> </ul>	Residential Noise 30-63 Livestock 30-36	
27/07/2022 18:30	59	42	25	— Stab Class. E	NPM Inaudible	
	Site L/	Aeq(15min) Con	tribution		<35	
			Night	t		
27/07/2022 23:56	44	32	28	WE	Wind 26-41 Livestock 25-37	
27/07/2022 00:11	67	43	29	- WD: W WS: 0.5m/s	Traffic 25-44 Residential Noise 30-67	
27/07/2022 00:26	42	30	28	— Stab Class: D	NPM - Hum <25 (barely to just audible throughout	
	Site L/	Aeq(15min) Con	tribution		<30	
Site LA1(1min) Contribution					<40	





**Table 13:** Attended noise monitoring results for Adavale

Date/Time (hrs)	Noise [	se Descriptor (dBA re 20 μPa)		Mataaralagu	Description and SPL -dPA
Duration 15min	LAmax	LAeq	LA90	<ul> <li>Meteorology</li> </ul>	Description and SPL, dBA
			Day		
27/07/2022 14:57	61	48	43	- WD: S WS: 2.0m/s	
27/07/2022 15:12	58	46	43		Wind 40-62 Birds 37-56
27/07/2022 14:27	62	49	42	— Stab Class: D	NPM Inaudible
	Site LA	Aeq(15min) Conf	tribution		<35
			Evenin	ig	
27/07/2022 20:15	40	28	14		Birds 20-40 Insects 15-25
27/07/2022 20:30	48	17	13	— WD: SW WS: <0.5m/s	Agricultural Noise 20-34 Dogs Barking 20-35
27/07/2022 20:45	35	19	14	- Stab Class: E	MAC Operator Noise 48 NPM Inaudible
	Site LA	Aeq(15min) Cont	tribution		<30
			Night	t	
27/07/2022 01:01	49	38	33	WD 6W	
27/07/2022 01:16	46	36	33	- WD: SW WS: 1.5m/s - Stab Class: D	Wind 30-49 NPM Inaudible
27/07/2022 01:31	48	37	34		
	Site LA	Aeq(15min) Conf	tribution		<30
	Site L	A1(1min) Contr	ibution		<40





Table 14: Attended road noise survey results

Table 8 Operator-Attended Road Noise Survey Results – Location NM4, Hillview					
Date/Time (hrs)	Measured Noise Level	Matanada	Criteria dB LAeq(1hr)	Description and CDL dDA	
Duration 1 hour	dB LAeq(1hr)	Meteorology		Description and SPL dBA	
				Wind 38-61	
				Birds 35-46	
27/07/2022		WD: SW		Traffic 35-67	
12:44	48	WS: 1.5m/s	55	NPM Concentrate Truck (offsite) 35-6	
(Day)		Stab Class: D		(2 passes)	
				(Approx. 19 vehicles Enter/Exit	
				NPM Site)	
				Traffic 23-65	
				Residential Noise 30-63	
27/07/2022		WD: W		Livestock 30-36	
18:00	47	WS: 0.5m/s	55	NPM Concentrate Truck (offsite) 35-6	
(Evening)		Stab Class: E		(2 passes)	
				(Approx. 72 vehicles Enter/Exit	
				NPM Site)	

Note: NPM denotes Northparkes Mines.